



- ### Repairs to Main Roof Parapets and Stair Turrets
1. Internally, review cracking to two quadrant landing stones. Access and inspect from above.
 2. Pin, grout and point to conserve scaling stonework and retain extant fragments of graffiti.
 3. St/sl pin to bond facing stone back to pinnacle.
 4. Allow for renewal here and in the base of the pinnacle where stones are spalling on the facet facing the roof. Additional access requirements for the upper sections.
 5. Consider replicating lead sill detail seen here on the other 3 doors at roof level.

B04 Building Element Repair Types

(PR.T1) Direct B04 repair type reference

B04 Repair Type: PR.T1

B04 Repair Type: PR.T2

B04 Repair Type: PR.T3

Zone of finial and turrets to be fully assessed at completion of scaffold access. Allow for:


B04 Repair Type: PR.T1 20 linear metres

B04 Repair Type: PR.T2 5 linear meters

B04 Repair Type: PR.T3 5m2



Rev.	Date	Drn.	Chkd.	Description

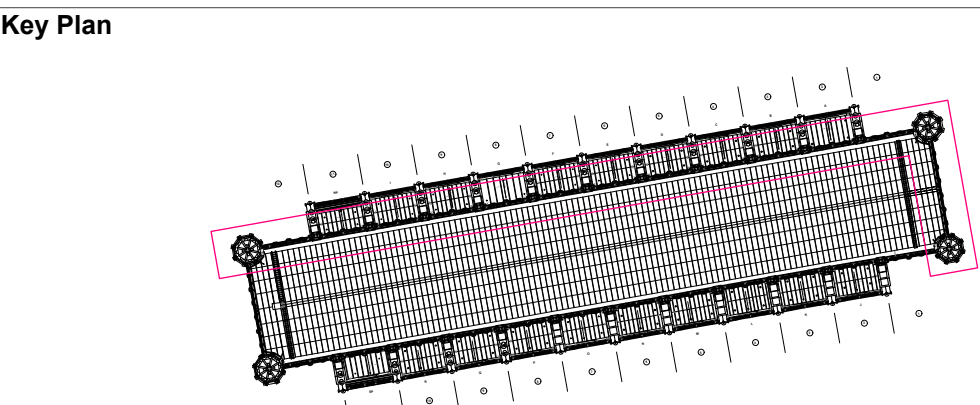

General notes:
Never scale dimensions from this drawing. Use written dimensions only. Report any discrepancies. Ask if in doubt. Always use latest revision.
Note that this drawing is based on dimensional surveys by others, therefore site verification of dimensional information is particularly important.
Read in conjunction with other information from CAL and other consultants.

Notes:



Stage 4 - For Tender		Not for construction	
CLIENT	SCALE	DATE	
King's College, Cambridge	1:100@A1	04.02.22	
PROJECT	DRAWN	CHECKED	
Roof Covering Renewal Project	GH	CAL	
DRAWING TITLE	JOB NUMBER	DRAWING NO.	REVISION
Masonry Repairs - North and East Parapets	099.4.1	WL 400.1	4.00



CAROE ARCHITECTURE LTD
Office 5, Unit 8, 23-25 Gwydir S
CAMBRIDGE CB1 2LG
TEL: 01223 472 237
WWW.CAROE.COM

The Surveyor's Office
St Paul's Cathedral
LONDON EC4M 8AD
TEL: 02072 468 341

Caroe Architecture Ltd. is a company limited by guarantee, registered in England & Wales. Registered no: 06927269; Lewis House, Great Chesterford, Essex CB10 1PF
ALL RIGHTS RESERVED